

INSTRUCTIONS TO USERS FOR OPERATION of Model 2400N95

Warnings to User:

1. Follow all instructions and warnings on the use of this respirator and wear during all times of exposure. Failure to do so will reduce respirator effectiveness, wearer protection and may result in sickness or death.
2. Before use, the user must first be trained by the employer in proper respirator use, in accordance with applicable safety and health standards, for the contaminant and exposure level in the assigned work area.
3. The particulates and other contaminants which can be dangerous to your health include those which you cannot see, taste, or smell.
4. This product has not been sold with warnings or use instructions for personnel involved in healthcare or related situations, where there may be the possibility of contact with disease or biological hazards. If you are considering such uses, first call the Moldex Technical Services Dept., +1 (310) 837-6500 or +1 (800) 421-0668, ext. 512/550

Use Against:

1. Particulate aerosols free of oil.
2. Nuisance levels (less than OSHA Permissible Exposure Limits) of Organic Vapor Odors and/or Ozone.

Do Not Use Against:

1. Concentrations of contaminants which are unknown, or are immediately dangerous to life or health.
2. Concentrations of particulates which exceed the maximum use concentration or 10 times the OSHA Permissible Exposure Limit, whichever is lower.
3. Gases, vapors, asbestos, paint spray, sandblasting or particulate materials which generate harmful vapors. **This respirator is not approved for any vapors or gases, so when used against organic vapor odors and/or ozone do not exceed the OSHA Permissible Exposure Limit.**
4. Oil-based mists.

Restrictions:

1. This respirator does not supply oxygen and must not be used in atmospheres containing less than 19.5% oxygen.
2. Do not remain in contaminated area if any physical distress occurs, for example breathing difficulty, dizziness or nausea.
3. Leave contaminated area and replace respirator if it is damaged, distorted, a proper fit can not be obtained or breathing becomes difficult.

4. Prior to each use, carefully inspect the entire respirator, including filter media and strap/weld attachment area for tears and damage. Staple or strap/weld attachment perforations do not affect respirator performance.
5. Do not alter, modify, or abuse this respirator.
6. Store unused respirators in box/bag in a clean, dry, non-contaminated area.
7. Dispose of respirator according to your employer's policy and local regulations.
8. Dispose no later than thirty days after first use.
9. Use respirator before the "use by" expiration date printed on box/bag.
10. If used for welding, wear appropriate eye and face protection.

Special User Instruction

S-This respirator offers nuisance level relief from organic vapor odors and/or ozone that are below the permissible exposure limit (PEL). Nuisance level refers to concentrations not exceeding the OSHA PEL or other government occupational exposure limits, whichever is lower*.

*Referenced from the NIOSH Approval Label.


Fitting Instructions

1. Users must follow instructions each time respirator is worn.
2. It's the wearer's responsibility to obtain a proper fit.
3. To choose the correct model/size Moldex Respirator you must fit test and user seal check.
4. If you cannot obtain a proper fit do not enter the contaminated area.
5. Before occupational use of this respirator, a written respiratory protection program must be implemented meeting all the local government requirements. In the United States, employers must comply with OSHA 29 CFR 1910.134 which includes medical evaluation, training, and fit testing. Additionally, the user must comply with any other applicable local and/or state regulations.
6. Use Moldex Qualitative Fit Test Kit. User must be clean-shaven. Any facial hair, such as beards or long sideburns, may prevent the respirator from fitting properly.
7. Eyewear must not interfere with face to facepiece seal.
8. Re-fit test when there are any changes to the wearer's physical condition that may affect fit.

Fitting Steps 1-4; Illustrations Below

1. Hold respirator in hand with molded nose contour (narrow end) at finger tips, allowing headstraps to fall below hand.
2. Place respirator under chin with molded nose contour (narrow end) up. Nose cushion must be uncreased inside respirator. Raise top strap to top back of head. Pull shorter bottom strap over head, below ears, to around neck. Do not wear with only one strap. When changing from any model/size to another respirator, you must fit test.

3. Adjust respirator for comfortable fit.
4. Each time user enters contaminated area seal should be fit checked. Cover front of respirator by cupping both hands. **INHALE SHARPLY**. A negative pressure should be felt inside respirator. If any leakage is detected at respirator edges, adjust straps by pulling back along the sides and/or reposition respirator. Repeat until sealed properly, otherwise see your supervisor. Entry into a contaminated area with an improper fit may result in sickness or death.

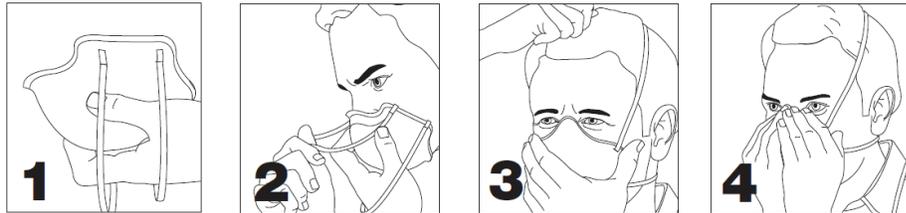

For technical assistance call Moldex Technical Service Department, +1 (800) 421-0668 or +1 (310) 837-6500, ext. 512/550.